

Work Order ID 92708

92708

Page 1

November-07-12 3:04:27 PM

Item ID: D212-664-101

Accept

N9000040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Fwd High

Start Date: 11/07/12 Start Qty: 1.00

1

Cust Item ID:

Required Date: 11/07/12 Req'd Qty: 1.00

1

Customer:

Reference:

Run Start

NR1

Approvals: Process Plan: MLJ Date: 12-11-08 Tooling:

Date:

Stop

NR2

QC: Date: SPC (Y/N):

Date:

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
----------	--------------

D212-664-141	Rev D (DEO)
--------------	-------------

100

100

DC

Document Control

DOCUMENT CONTROL

Memo

Photocopy bluefile and create labels as per PPP D212-664-101 CHG005

0.00

0.00

110

110

Packaging

Packaging

Pick Kit
Packaging

Memo

0.00

0.00

120

120

CNC Bend 2

CNC Alpha 160 Bender

BENDING MACHINE - CROSSTUBES

Memo

Bend tube as per Dwg D212-664-141 using CNC bender program 212-fw and Folio D212-664-101

0.00

0.00

B92708 D212-664-101

1 OK MLJ 12-11-28

MO 12/11/15

Rev 12-11-16
TLW

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped.	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabelled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

Work Order ID 92708

92708

Page 2

November-07-12 3:04:27 PM

Item ID: D212-664-101 Accept *N900040100* Setup Start *NS1*
 Revision ID: Stop *NS2*
 Item Name: Crosstube Fwd High
 Start Date: 11/07/12 Start Qty: 1.00 *1* Cust Item ID:
 Required Date: 11/07/12 Req'd Qty: 1.00 *1* Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130	QC15- Crosstube Dimensional Check	0.00							
130									
QC	Memo	0.00							
Quality Control									
140		0.00							
140	Crosstubes								
Crosstubes	Memo	0.00							
Crosstubes	1-Drill pilot holes in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549, using drill table DT8577, set-up towers in hole #7 as per QSI 10								
	2-Ream hole to finish size in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.								
	3-Scribe part # and batch # using vibrating stylus as per Dwg D212-664-141								
	4-*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D212-664-141								

68-5
11
DAS
03
2-89

DP

12-11-16

Rm/MO 12-11-19

Rm 12-11-19

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped.	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabelled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

Work Order ID 92708

92708

Page 3

November-07-12 3:04:27 PM

Item ID: D212-664-101

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Crosstube Fwd High

Start Date: 11/07/12 Start Qty: 1.00

1

Cust Item ID:

Required Date: 11/07/12 Req'd Qty: 1.00

1

Customer:

Reference:

Run Start *NR1*

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop *NR2*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

150

QC5- Inspect part completeness to step on W/O

0.00

150

QC

Memo

0.00

Quality Control

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

160

0.00

160

HandFXtube

Memo

0.00

Hand Finishing Crosstubes

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

1- CLEAN CROSSTUBE WITH WASH'N WIPE

170

Outsource process - NDT per QSI038 4.1

0.00

170

Outsource2

Memo

0.00

Outsource process - NDT

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

Liquid Penetrant Inspection as per QSI 038

Issue P/O:

LPI as per ASTM 1497 Level 2

Attach copy of NDT results to work order

DAS 05 12 11 20

112-11-22

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS			
Part No. _____		Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>
NCR No. _____		Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>
		Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>
		Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

FAULT CATEGORY

Landing Gear	General	
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

Work Order ID 92708

92708

Page 4

November-07-12 3:04:27 PM

Item ID: D212-664-101

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Crosstube Fwd High

Start Date: 11/07/12 Start Qty: 1.00 *1*

Cust Item ID:

Required Date: 11/07/12 Req'd Qty: 1.00 *1*

Customer:

Reference:

Run Start *NR1*

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop *NR2*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
180	Receive & Inspect for Damage & Mat'l Certs	0.00							
180	Packaging								
Packaging	Memo	0.00							
Packaging	Ensure copy of NDT results attached to work order.								
190	QC5- Inspect part completeness to step on W/O	0.00							
190									
QC	Memo	0.00							
Quality Control	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
	Inspect for damage & ensure results are as per Dwg D212-664-141								
193	Crosstubes Chemical Conversion	0.00							
193									
HandFXtube	Memo	0.00							
Hand Finishing Crosstubes	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
	1- PRESSURE WASH AND THEN USE WASH'N WIPE TO CLEAN CROSSTUBE BEFORE CHEMICAL CONVERSION								

12/14/22

12/11/22

12/11/22

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

FAULT CATEGORY

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped.	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

Work Order ID 92708

92708

Page 5

November-07-12 3:04:27 PM

Item ID: D212-664-101

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Fwd High

Start Date: 11/07/12 Start Qty: 1.00

1

Cust Item ID:

Required Date: 11/07/12 Req'd Qty: 1.00

1

Customer:

Reference:

Run Start

NR1

Approvals:

Process Plan:

Date:

Tooling:

Date:

Stop

NR2

QC:

Date:

SPC (Y/N):

Date:

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

195

QC7-Inspect Chemical Conversion Coat

0.00

195

QC

Memo

0.00

Quality Control

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

DAS
05
12/11/27

200

Spray Painting per QSI005 4.2

0.00

200

SprayPaint

SprayPaint

Memo

0.00

Spray Painting

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube as per DEO D212-667-141 with White Imron as per QSI 005 4.2

PRIME: 122888

Start Time: 7:00

Finish Time: 8:00

PAINT: 123591

Start Time: 1:30

Finish Time: 2:30

1 0 0 AP
12-11-22

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>						
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector			
Doc/Data												
Equip/Tooling												
Operator												
Material												
Setup												
Other												
Process												
Supplier												
Training												
Unapproved												
FAULT CATEGORY												
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other	

Work Order ID 92708

November-07-12 3:04:27 PM

92708

Page 6

Item ID: D212-664-101

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Crosstube Fwd High

Start Date: 11/07/12 Start Qty: 1.00

1

Cust Item ID:

Required Date: 11/07/12 Req'd Qty: 1.00

1

Customer:

Reference:

Run Start *NR1*

Approvals: Process Plan: Date: Tooling: Date:

Stop *NR2*

QC: Date: SPC (Y/N): Date:

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

210

QC14- Inspect Spray Paint

0.00

210

QC

Memo

0.00

Quality Control

Then, Wrap in plastic bag to protect from scratches

220

Crosstubes

0.00

220

Crosstubes

Memo

0.00

Crosstubes

1-Abrade mating surfaces of support and crosstube with 400 grit sandpaper, clean the area with 4105S wash 'n' wipe

2-Install supports with Proseal 890 per DSI9563 and QSI 015

A/R Proseal 890 Batch: 123103

3- Torque bolts as per dwg

230

QC6- Inspect dimensions to drawing

0.00

230

QC

Memo

0.00

Quality Control

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											
FAULT CATEGORY											
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other		

Work Order ID 92708

92708

Page 7

November-07-12 3:04:27 PM

Item ID: D212-664-101

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Fwd High

Start Date: 11/07/12 Start Qty: 1.00

1

Cust Item ID:

Required Date: 11/07/12 Req'd Qty: 1.00

1

Customer:

Reference:

Run Start

NR1

Approvals:

Process Plan:

Date:

Tooling:

Date:

Stop

NR2

QC:

Date:

SPC (Y/N):

Date:

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

240

Pick Kit

0.00

240

Packaging

Memo

0.00

Packaging

250

QC4- 100% Inspect kits for completeness

0.00

250

QC

Memo

0.00

Quality Control

260

Packaging

0.00

260

Packaging

Memo

0.00

Packaging

Identify and pack for shipping as per PPP D212-664-101

6/11/29
DAS
20
9-89

12-11-27

DAS
15
9-89
12/11/29

PK 103

DAS
20
9-89

12/11/29

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="width: 25%;">Skid-tube <input type="checkbox"/></td> <td style="width: 25%;">Crosstube <input type="checkbox"/></td> <td style="width: 25%;">Water Jet <input type="checkbox"/></td> <td style="width: 25%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

Work Order ID 92708***92708***

Page 8

November-07-12 3:04:27 PM

Item ID: D212-664-101

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Fwd High

Start Date: 11/07/12 Start Qty: 1.00

1

Cust Item ID:

Required Date: 11/07/12 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
270	QC21- Final Inspection - Work Order Release	0.00							
270									
QC	Memo	0.00							
Quality Control									

12/12/3 JF
ME
12-11-30

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="width: 25%;">Skid-tube <input type="checkbox"/></td> <td style="width: 25%;">Crosstube <input type="checkbox"/></td> <td style="width: 25%;">Water Jet <input type="checkbox"/></td> <td style="width: 25%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		
<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other		

Picklist Print

November-07-12 3:04:26 PM

Page 1

Work Order ID: 92708
 Parent Item: D212-664-101
 Parent Item Name: Crosstube Fwd High

Start Date: 11/07/12

Required Date: 11/07/12

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:E04.02.16ReformatKJ/DS
 IPP Rev:F 06-03-29 Remove Coments on Pick List JLM
 IPP Rev:G 07-04-30 As per Rev C JLM IPP Rev:H 11.04.26 inspection
 strip ecn 11-549 EC verified by:DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D212-664-101TRN Crosstube Turning Detail		Manufactured	No			110	Each	2.0000	1	1			
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				LG	92856	2							
					89875	1							
					89876	1							
D3595-063-450 RUBBER CUSHION		Manufactured	No			230	Each	219.8895	4	4.2105263			
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				FG		5							
					88422	5							
				LG		0.28							
					82511	0.28							
				LG051		179.5							
					80161	1.7							
					84715	2							
					87478	130							
					88916	1.8							
					90968	44							
				MAT052		35.109474							
					67353	2							
					68893	6							
					70113	0.56							
					71354	0.2							
					74113	0.349474							
					75597	1							
					92056	25							

① MO 12/11/15

AD 12-11-23

④

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

Picklist Print

November-07-12 3:04:26 PM

Work Order ID: 92708
 Parent Item: D212-664-101
 Parent Item Name: Crosstube Fwd High

Start Date: 11/07/12 Required Date: 11/07/12
 Start Qty: 1.00 Required Qty: 1.00

MS21920-25
 Clamp(per MIL-DTL-8783C)

Purchased No

220 Each 103.0000 4 4

AP 12-11-23

Location	Loc Qty	Loc Code
FG	2	
120920	2	
LG050	74	
116264	2	
117998	4	
118142	4	
119339	2	
119746	2	
120475	3	
120920	7	
123243	50	(4)
LG051	27	
122838	27	

D2893-1
 2.75 Support

Manufactured No

220 Each 29.0000 2 2

AP 12-11-23

Location	Loc Qty	Loc Code
LG052	29	
72865	2	
87289	7	
89624	20	

D3428-1
 Placard

Manufactured No

240 Each 0.0000 1 1

B93489 SP

AN6-35A
 BOLT

Purchased No

240 Each 42.0000 4 4

SP 12-11-27

Location	Loc Qty	Loc Code
342	1	
121181	1	
ST340	41	
122416	21	
122800	20	

SMB

4x

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

FAULT CATEGORY

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped.	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabelled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

Picklist Print

November-07-12 3:04:26 PM

Page 3

Work Order ID: 92708
 Parent Item: D212-664-101
 Parent Item Name: Crosstube Fwd High

Start Date: 11/07/12

Required Date: 11/07/12

Start Qty: 1.00

Required Qty: 1.00

AN6-36A
 Bolt

Purchased No

240 Each 59.0000

4

4

SP

Location	Loc Qty	Loc Code
ST340	49	
122416	3	
122993	46	
ST342	10	
118422	2	
119449	1	
120187	4	
120423	3	

SMB

MS21042L6
 Nut

Purchased No

240 Each 892.0000

6

6

SP

Location	Loc Qty	Loc Code
314	153	
122441	153	
ST300	239	
117677	25	
118384	3	
118927	48	
119075	4	
120308	159	
ST314	500	
123248	350	
123355	150	

SMB

AN960JD616
 Washer

NAS1149D0663J

Purchased No

240 Each 0.0000

18

18

M/D 3265

SP 12-11-27

SMB

November-07-12 3:04:26 PM

Shop Packet Print

Page 3

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																


Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

DART AEROSPACE LTD	Work Order: 92708
Description: Crosstube High Fwd (205/212/412)	Part Number: D212-664-101
Inspection Dwg: D212-664-141 Rev: D	Page 1 of 1

Required Dimension	Min	Max
Height	26.79	27.05
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.7
Bending Passes	3	--
Crushing	--	6%

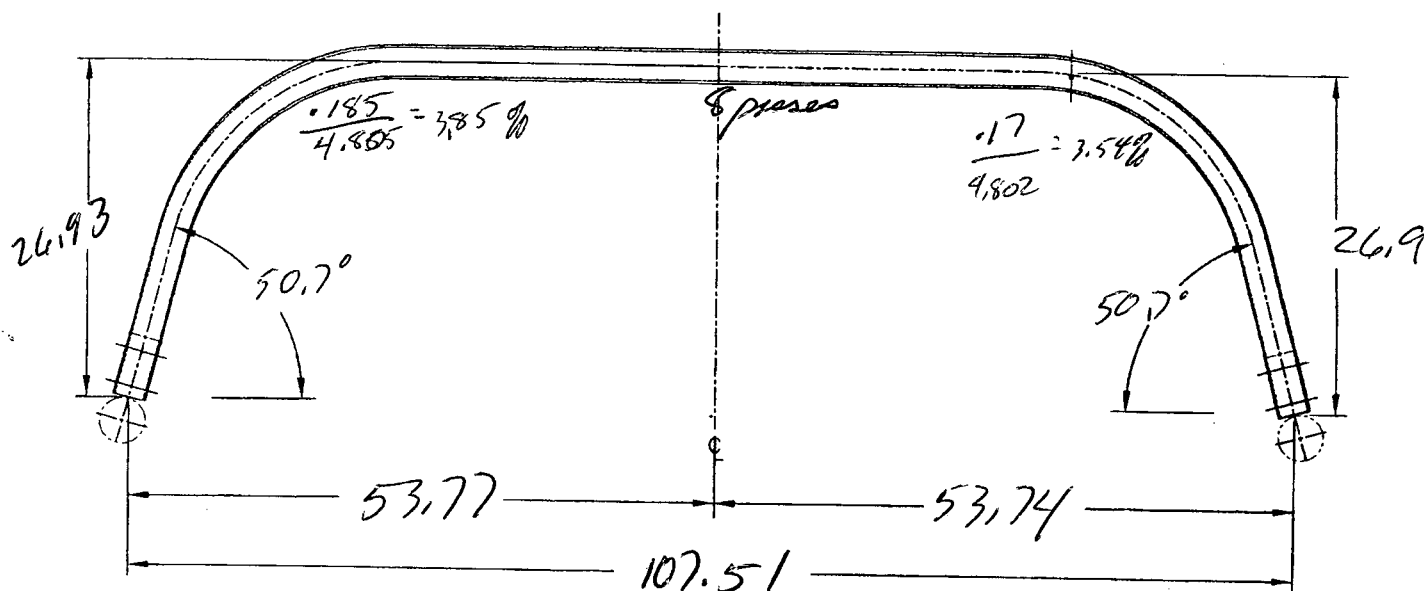

	Side A	Side B
Bending Passes	5	6
Crushing	3.85%	3.54%
Comments		

QC15 Inspection	
Date	12-11-16

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	08.04.21	Dwg Rev updated	KJ/JM	
C	10.04.01	Dwg Rev updated	KJ	
D	12.04.16	Added bending, crushing dimensions	KJ	

Item	Qty -141	Qty -141B	Part Number	Description
1	X		D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
2		X	D212-664-141B	CROSSTUBE ASSEMBLY (214 HIGH FWD)
3	1	1	D6005-128	CROSSTUBE
4	2	2	D2893-1	SUPPORT
5	4	4	D3595-063-450	RUBBER CUSHION
6	4	4	MS21920-25	CLAMP (OR MS21920-26)
7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6005-128
FINISHED LENGTH = 126.514±0.020
- FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF
USING VIBRATING STYLUS
- WEIGHT: D212-664-141 = 33.6 lbs (PER IIN-D212-664)
D212-664-141B = 33.6 lbs (PER IIN-D212-664)
- PART IS SYMMETRIC ABOUT CENTERLINE.
- RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE D2893-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER

NO. 92708 ML5
12-11-08

REMOVED FLAG UNDER REVIEW PER
UNDER REVIEW ECHN H-614
4/18/12
FOR PRO-SEALING SUPPORT 2.8.07.26

DEO ATTACHED

RELEASED
2009-10-29
M

D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -141B (ZN B4-2, D4-2); REMOVED REF & ADD TOLERANCES (ZN B4-3, C6-3, C8-3 & B6-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE, TO SHEET 4	RF	09.09.30
C	REMOVE -851 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PH	DRAWING NO.	REV. D
MFG. APPR.	PH	D212-664-141	SHEET 1 OF 4
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	XTUBE ASSY (205/212/412 HI FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

8 7 6 5 4 3 2 1

92708

12 13 15
D2893-1 SUPPORT
MS21920-25 CLAMP, 2X
D3595-063-450 RUBBER CUSHION, 2X
2 PL

A4-2
A

14.00 (-141)
OR 13.75 (-141B)



D212-664-501
BENT TUBE

Q
SYM


D212-664-141/-141B
ASSEMBLY DETAIL



ECW#11-614
11.07.20
UNDER REVIEW
11.08.13

DEO ATTACHED


RELEASED
2009-10-29

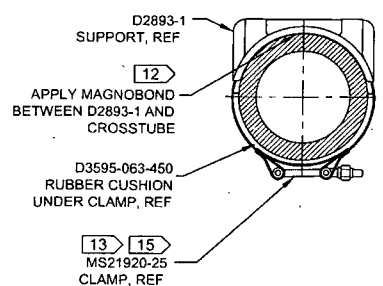


SECTION A-A D5-2
SCALE 4X

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	97	DRAWING NO.	REV. D
MFG. APPR.	10	D212-664-141	SHEET 2 OF 4
APPROVED	10	TITLE	SCALE
DE APPR.	11	XTUBE ASSY (205/212/412 HI FWD)	NTS
DATE	09.09.30	<small>COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS COVENANT THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD</small>	

8 7 6 5 4 3 2 1

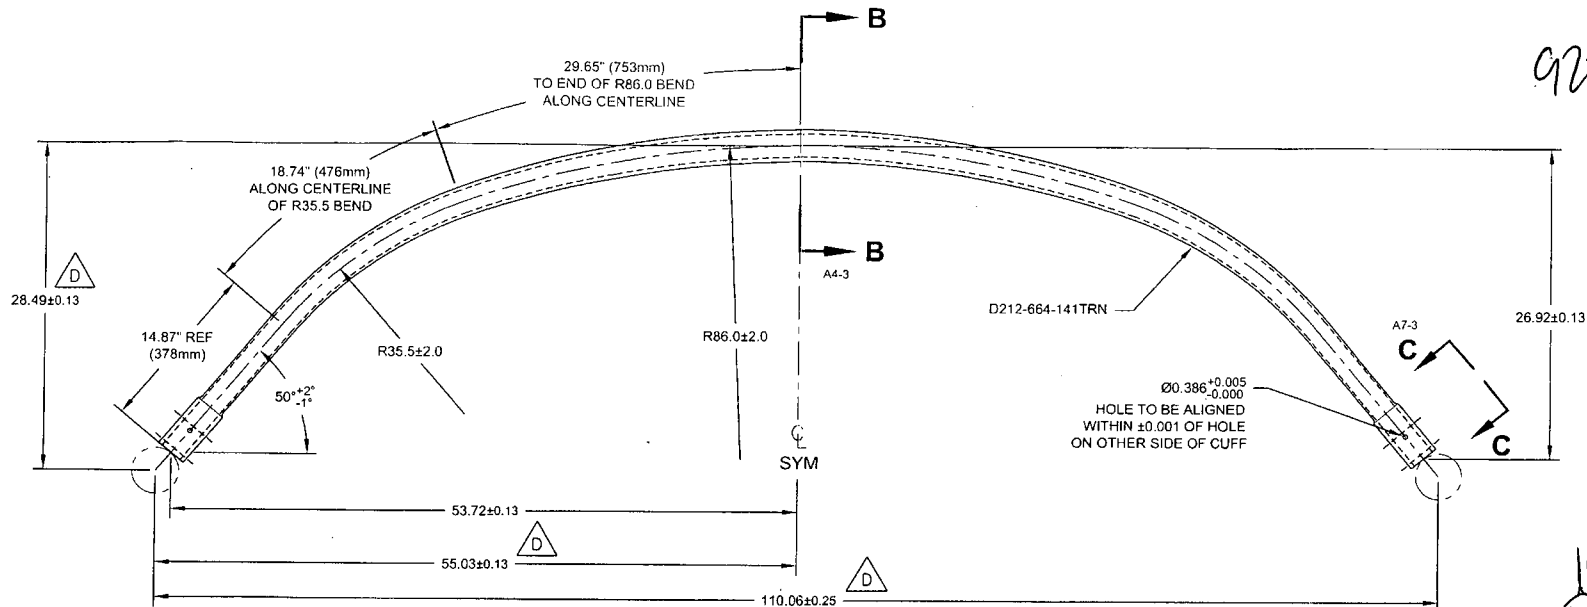


D212-664-501
BENDING AND DRILLING DETAIL

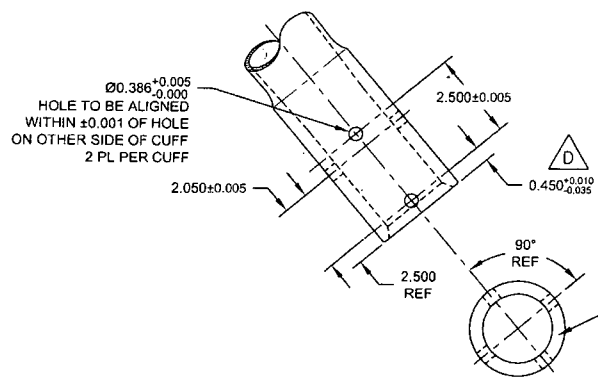

VIEW C-C: CUFF DETAIL
SCALE 3X

C2-3

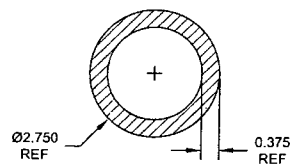

SECTION B-B
SCALE 4X

C4-3



UNDER REVIEW

11.09.30

DEO ATTACHED

RELEASED
2009-10-29

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	Q	DRAWING NO.	REV. D
MFG. APPR.	Q	D212-664-141	SHEET 3 OF 4
APPROVED	AP	TITLE	SCALE
DE APPR.	AP	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. IT IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

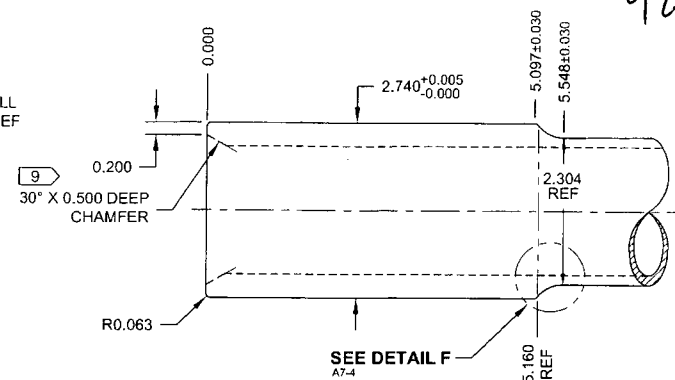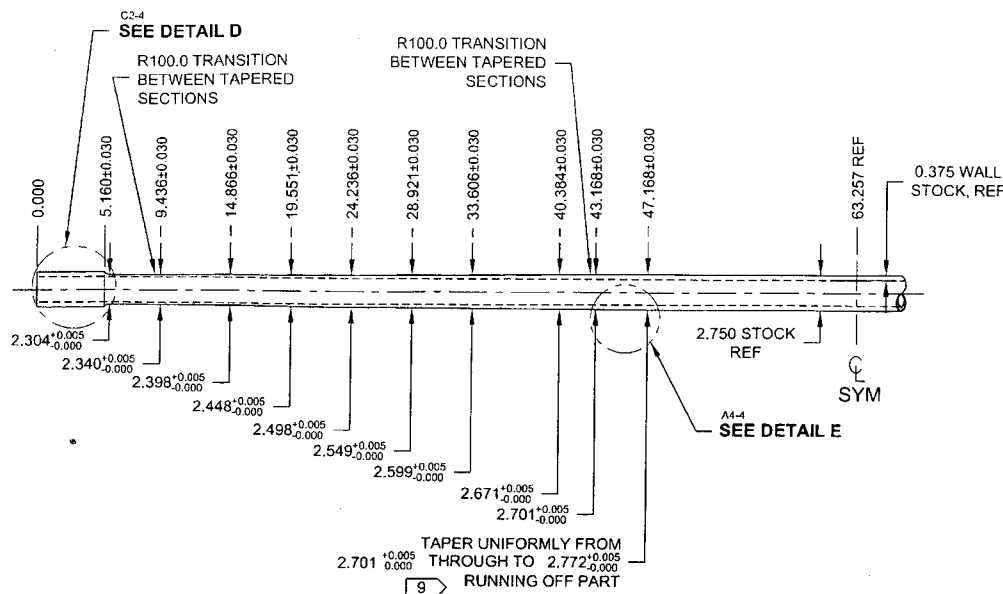


DETAIL D:
CROSSTUBE CUFF D8-4
SCALE 5X


UNDER REVIEW

DEO ATTACHED

RELEASED
2009-10-29

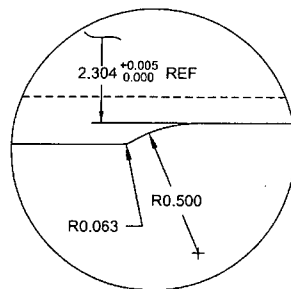

DETAIL F:
CUFF TRANSITION C2-4
SCALE 10X

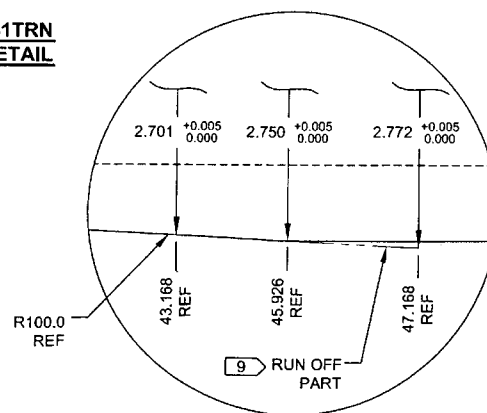

DETAIL E:
TAPER RUN-OFF C5-4
NOT TO SCALE

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	92	DRAWING NO.	REV. D
MFG. APPR.	18	D212-664-141	SHEET 4 OF 4
APPROVED	140	TITLE	SCALE
DE APPR.	14	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

92700

DRAWING NO. D212-664-141	TITLE XTUBE ASSY (205/212/412 HI FWD)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-141-D-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED	DE APPR.			
DATE 11.04.07	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12			

PURPOSE:

ADD AN INSPECTION WINDOW TO UNDERSIDE OF CROSSTUBE.

CHANGE:

NOTES 2 OF SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA) AND
PAINT OUTSIDE PER DART QSI 005 4.2
REMOVE MASKING AND APPLY CLEAR COAT

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2

RELEASED
2011-04-18

UNDER REVIEW

11/06/13
ECN 11-614
11.07.28

92708

DRAWING NO. D212-664-141	TITLE XTUBE ASSY (205/212/412 HI FWD)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D212-664-141-D-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED <i>CP</i>	MFG. APPR. <i>CE</i>	APPROVED <i>WPD</i>	DE APPR. <i>WPD</i>		
DATE 11.04.07	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12		


IS:

WAS:


UNDER REVIEW

9/11/06.13

ECN# 11-614
11.07.28

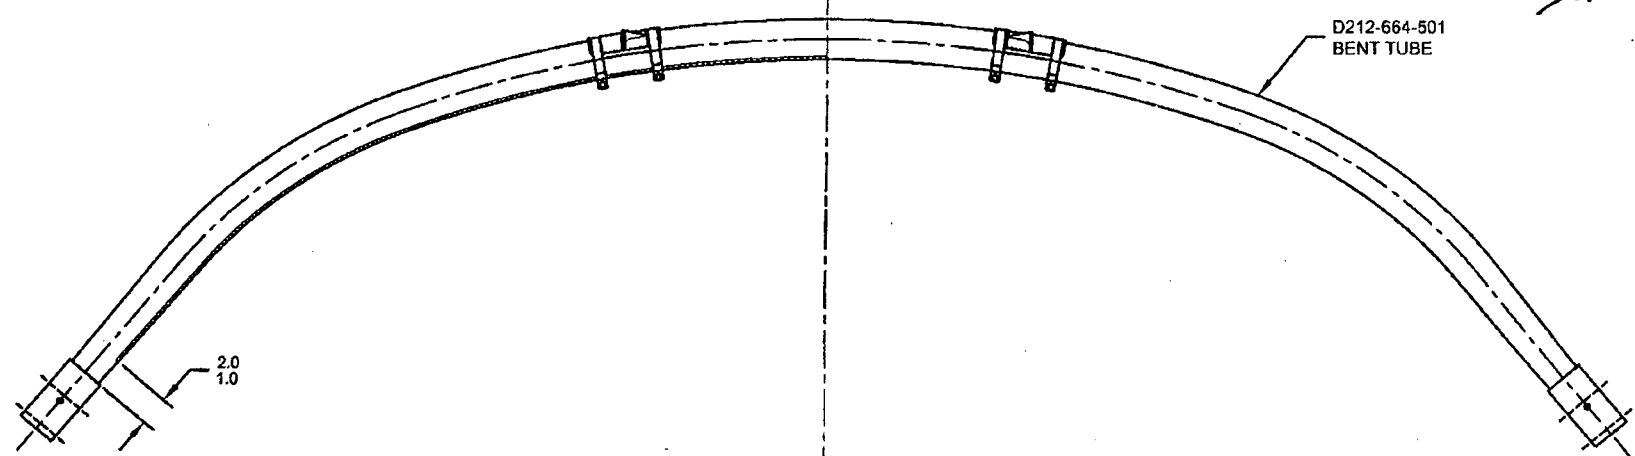

**D212-664-141/-141B
ASSEMBLY DETAIL**

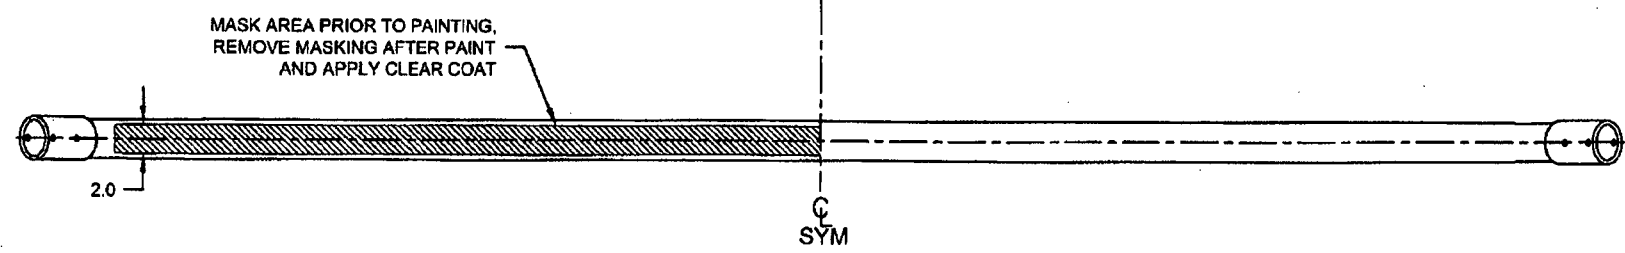

COPYRIGHT © 2011 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

92708

DRAWING NO. D212-664-141	TITLE CROSSTUBE ASS'Y (205 HI FWD)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-141-D-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>UP</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>AS</i>	APPROVED <i>MD</i>		DE APPR. <i>HH</i>		
DATE 11.07.15	DATE 11.07.20	DATE 11.07.21	DATE 11/07/21		DATE 11.07.21		

PURPOSE:

REPLACE MAGNOBOND WITH PROSEAL.

CHANGE:

IS:

Item	Qty -141	Qty -141B	Part Number	Description
7	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) TO INSTALL D2893-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

- 12) INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RECEIVED
2011-07-28
MD

92708

DRAWING NO. D212-664-141		TITLE XTUBE ASSY (205/212/412 HI FWD)		REV. D DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-141-D-3		SHEET NO. SHEET 1 OF 1		SCALE NTS	
DRAWN AJS		CHECKED 9		MFG. APPR. 140		APPROVED 140		DE APPR. 140			
DATE 12.06.28		DATE 12.07.05		DATE 12.07.05		DATE 12.07.05		DATE 12.07.05			

PURPOSE:

ADD NEW CONFIGURATION WITH ANODIZED FINISH

ADD -141F CONFIGURATION TO PARTS LIST AS SHOWN BELOW:

Item	Qty -141	Qty -141B	Qty -141F	Part Number	Description
1	X			D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
2		X		D212-664-141B	CROSSTUBE ASSEMBLY (214 HIGH FWD)
			X	D212-664-141F	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD) (ANODIZED)
3	1	1	1	D6005-128	CROSSTUBE
4	2	2	2	D2893-1	SUPPORT
5	4	4	4	D3595-063-450	RUBBER CUSHION
6	4	4	4	MS21920-25	CLAMP (OR MS21920-26)
7	A/R	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

*NOTE ITEM 7 HAS BEEN UPDATED IN ACCORDANCE WITH DEO D212-664-141-D-2

AMEND NOTE 2 AS FOLLOWS:

IS:

- 2) FINISH -141 & -141B ONLY: a) CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
b) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
c) MASK UNDERSIDE OF CROSSTUBE AS SHOWN IN DEO D212-664-141-D-1
d) PAINT OUTSIDE PER DART QSI 005 4.2
e) REMOVE MASKING AND APPLY MATTE CLEAR COAT

- FINISH -141F: a) ANODIZE PER MIL-A-8625. TYPE II. CLASS 1.
b) ALODINE (DO NOT ETCH) PER QSI 005 4.1.2
c) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
d) MASK UNDERSIDE OF CROSSTUBE AS SHOWN IN DEO D212-664-141-D-1
e) PAINT OUTSIDE PER DART QSI 005 4.2
f) REMOVE MASKING AND APPLY MATTE CLEAR COAT

***NOTE:** BETWEEN FINISHING OPERATIONS EXTREME CARE MUST BE TAKEN
NOT TO CONTAMINATE OR DAMAGE FINISHED SURACES.

WAS: (UPDATED PER DEO D212-664-141-D-1)

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN IN DEO D212-664-141-D-1
PAINT OUTSIDE PER DART QSI 005 4.2
REMOVE MASKING AND APPLY CLEAR COAT

RELEASED
2012-07-10
9



LIQUID PENETRANT TEST REPORT

P- 12685

CLIENT
ATTENTION
ADDRESS
PROJECT
ITEM(S) EXAMINED

DART Aerospace
MAT
1270 ABEL DEEN ST
HAWKESBURY, ON.

DATE
ACUREN JOB NO.
PO/NO No.
WORK LOCATION
ACCEPTANCE STD

Nov. 20/2012
180-12-0822
SAME
ASTM 1417/05-030
REV./DATE 2005

PAGE 1 OF 1
TIME AM ☒ PM ☐

F.P.I. on CROSS TUBES, MACHINED PARTS
(7)

JOB DESCRIPTION
PROCEDURE No. LT-002 REV./DATE 2008
TECHNIQUE No. LT-002 REV./DATE 2008
PART No. SEE RESULTS
SCOPE A WET FLUORESCENT DYE PENETRANT INSPECTION WAS CARRIED OUT 100% EXTERNAL SURFACE
MATERIAL STAINLESS/ALUMINUM THICKNESS VARIOUS

TEST DETAILS
METHOD ☒ FLUORESCENT ☐ VISIBLE
FAMILY BRAND MAGNAFLUX
PENETRANT 2LG7 MINIMUM DWELL TIME 45 MIN.
PENETRANT REMOVER H2O MINIMUM DRY TIME >10 MIN.
DEVELOPER SKD 52 MINIMUM DWELL TIME 10 MIN.
DEVELOPER TYPE ☒ NON AQUEOUS ☐ AQUEOUS ☐ DRY
☒ WATER WASH ☐ SOLVENT REMOVABLE ☐ POST EMULSIFIED
BLACK LIGHT S/N 16439 ☐ OUTPUT > 1000 μ W/cm² ☐ AMBIENT < 2 fc
LIGHTING EQUIP. ☐ FLASHLIGHT ☐ TROUBLELIGHT ☐ OUTPUT > 100 fc @ SURFACE
OTHER LABINO
LIGHT METER S/N 1098866 CAL DUE DATE Nov 24 2012

TEST SURFACE
SURFACE CONDITION ☐ AS GROUND ☐ AS WELDED ☒ MACHINED ☐ SHOT BLASTED ☒ CLEAN BARE METAL
SURFACE TEMPERATURE ☐ < -4°C/ 20°F ☐ -4°C/ 20°F TO 10°C/50°F ☐ 10°C/50°F TO 52°C/125°F ☐ > 52°C/125°F

RESULTS- ☒ METRIC ☐ IMPERIAL

ITEM	COMMENTS	ACCEPT	REJECT
12 - Mount, W.O. # 89361		✓	
1 - CLASS TUBE - W.O. # 92890		✓	
1 - " " " # 92889		✓	
1 - " " " # 92745		✓	
1 - " " " # 90206		✓	
1 - " " " # 79630		✓	
1 - " " " # 92708		✓	
1 - " " " # 92707		X	

Scope of Services
The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.
Standard of Care
In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

SIGNATURES

CLIENT REPRESENTATIVE Matthew Murdoch
TECHNICIAN (SIGNATURE): Mike Johnston
NAME (PRINT):
CGSB LEVEL 1ST TECHNICIAN SNT LEVEL 2ND TECHNICIAN
CGSB REG. NO. 6606 CGSB REG. NO.
DTR # E-120597
REPORT REVIEWED BY: NAME INITIALS